



SOFTWARE RELEASE NOTES

MCS-MAGNUM Version 17.12F 01/07/2015

Updates from previous versions:

Bug Fixes:

HVAC Firmware only –

1. Corrected issue with new Comp Lockout Reset Relay - coding using 1 to enable the new feature but it needs to be a zero to enable because all config files have this new control byte set to 0xFF.
2. Corrected issue with new feature added to all turbocor comp to stop unloading when starting the next comp and disch pressure ratio is good. Needed to use correct index (turbo_index).
3. Corrected issue in turbocor logic - setpoint #215 has two decimal places - need to use disch_suct_ratio instead of lift_evap_ratio.
4. Corrected issue with Turbocor logic - corrected test to allow logic to get out of unloading running comps when all the running comp suct/disc ratio is good - test was added wrong.

Any questions regarding this release, contact:
support@mcscontrols.com

Micro Control Systems, Inc. 5580 Enterprise Parkway Fort Myers, Florida 33905
(239)694-0089 FAX: (239)694-0031 www.mcscontrols.com

Information contained in this document has been prepared by Micro Control Systems, Inc. and is copyright © protected 2015. Copying or distributing this document is prohibited unless expressly approved by MCS.